

2251 S.E. OAK GROVE BLVD., OAK GROVE, OREGON 97267

www.cranston-machinery.com

+ 001 (503) 654-7751


Bulletin No: L047 Issued: 101230

3 MT Swivel Cap Bolt and Seal Conversion Kit - PA8180:

This Kit pertains only to Models 26A058, 26A059, 26A082, 26A086, 26A087, and 26A092 UNIHOOK™

Parts included in kit:

Item	Quantity	Part Number	Description
1	1	CA8709000	Тор Сар
2	1	M57000001	U Cup Seal
3	1	AA8777000	Swivel Bolt
4	1	AA8778000	Swivel Bolt Washer

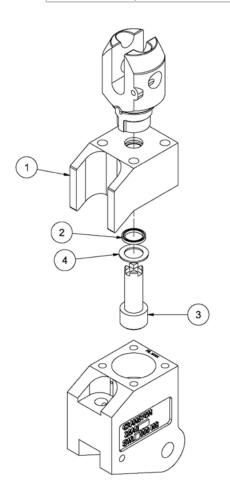

CONVERSION INSTRUCTIONS

The following instructions assume that a technician familiar with UNIHOOK[™] disassembly and reassembly will be making this conversion. If this is not the case, then refer to the UNIHOOK[™] Bulletin that shipped with the original UNIHOOK[™] for additional assembly tips.

- 1. Remove the existing tie bolts that connect the top cap to the hook body.
- 2. Remove the existing swivel bolt and swivel bolt washer and discard.
- 3. Install the new U Cup Seal, Item 2, into the groove in the bore of the new Top Cap, Item 1. Make sure the legs of the U point upwards.
- 4. Install the new Swivel Bolt, Item 3, and Swivel Bolt Washer, Item 4 through the Top Cap and into the existing Swivel.
- 5. Reinstall the tie bolts through the Top Cap and into the Hook Body.

If you have any questions regarding this modification or any of the parts listed above are not in the conversion kit, please contact Cranston Machinery Co. Inc.

Keep this bulletin with your existing Unihook information for future reference.

Please visit us at: **cranston-machinery.com**

Our phone number is: + 001 (503) 654-7751